

# TECHNICAL SERVICE POINTER

## For Immediate Attention of Your Service Department

Technical Service Pointer: W11287497

Action Required: Information

Publication Date: August 1, 2018

### Brands Affected



## COMMERCIAL LAUNDRY Front-Load Washer Belt Change

### Models


MHN33	MLx22
CHW9150 / 60	CxT9000 / 9100
2641952K	

### Description

Front-load washers may experience belt slippage and / or premature belt wear. This can be evidenced by belt dust accumulation and spin or basket speed issues.

### Production Correction

Starting in early August with serial numbers beginning at C831, production will implement an 8-rib belt, replacing the current 6-rib belt. The 8-rib belt will provide higher performance and reliability from belt wear and slippage. The 8-rib belt is available as service part number WPW10388418.

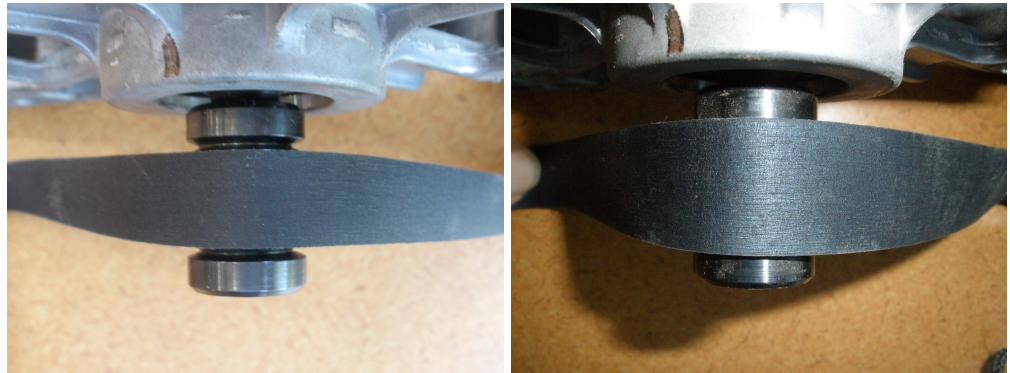

### QUESTIONS?

Please contact your Customer Relations Manager.

### ALL POINTERS ONLINE:

[www.serviceconnections.org/](http://www.serviceconnections.org/)